
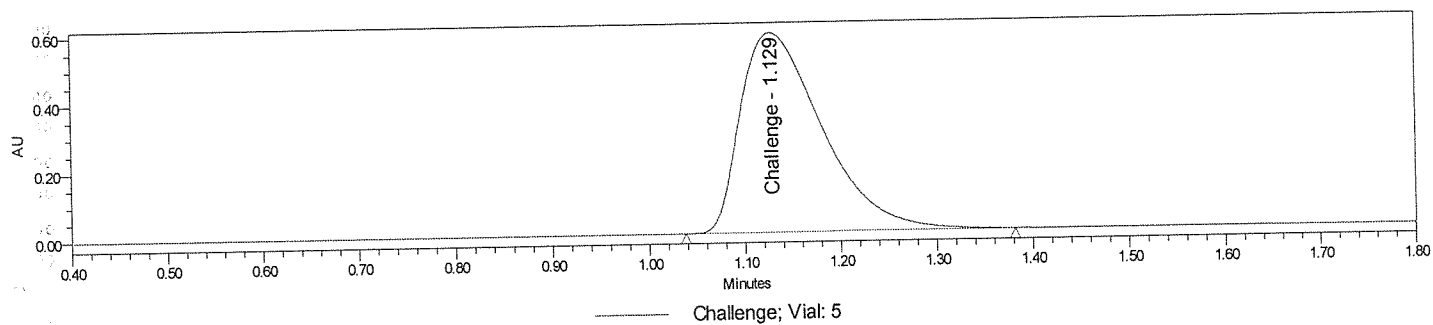


Part Number: 186269506
 Tested By: SYLVESTER
 Serial Number: F18SM4632A
 UUT Firmware: 3.04

Description: 2695 Separations Module
 Test Template Revision: 1.8
 Test Station: Final-test-5
 System: 2695_1

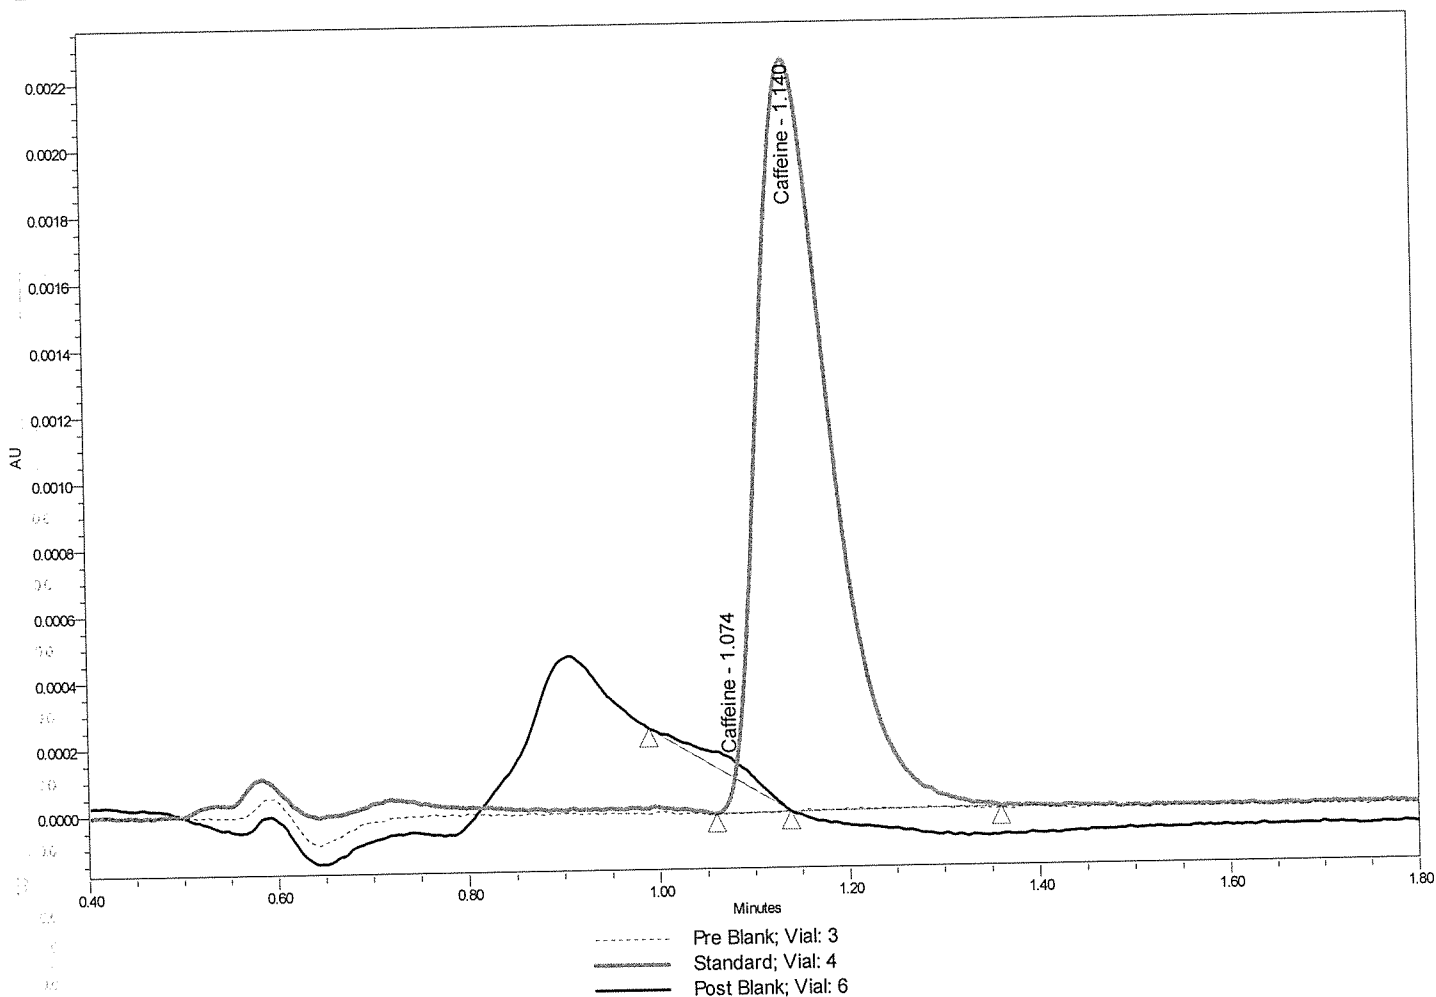

	Date Acquired	SampleName	Area	Percent
1	6/12/2018 6:11:06 PM SGT	Pre Blank		
2	6/12/2018 6:13:49 PM SGT	Standard	11936	0.0100
3	6/12/2018 6:16:33 PM SGT	Challenge	3478095	
4	6/12/2018 6:32:30 PM SGT	Post Blank	229	0.0002



Carryover Test:
 PreBlank injection (to establish system cleanliness)
 Standard (0.4 PPM) Caffeine injection
 Challenge injection (10,000 X Standard = 4,000 PPM)
 PostBlank injection
 Carryover (%) = Carryover Area/Standard Area * 0.010

Specification: Post Blank Percent < 0.002
 (or Blank peak(s) missing/blank)

This Test Record and any data contained within it are proprietary to Waters Corporation and must be retained by Waters for the time period prescribed in its Quality Records Retention Policy. If any of the individual tests fail; a note must be referenced that details the work performed to correct that specific deficiency. An overall failure indicates a special circumstance in which case a complete retest is to be done. A second form is required to document that testing; the initial form must be attached and retained.

Part Number: 186269506
 Tested By: SYLVESTER
 Serial Number: F18SM4632A
 UUT Firmware: 3.04

Description: 2695 Separations Module
 Test Template Revision: 1.8
 Test Station: Final-test-5
 System: 2695_1

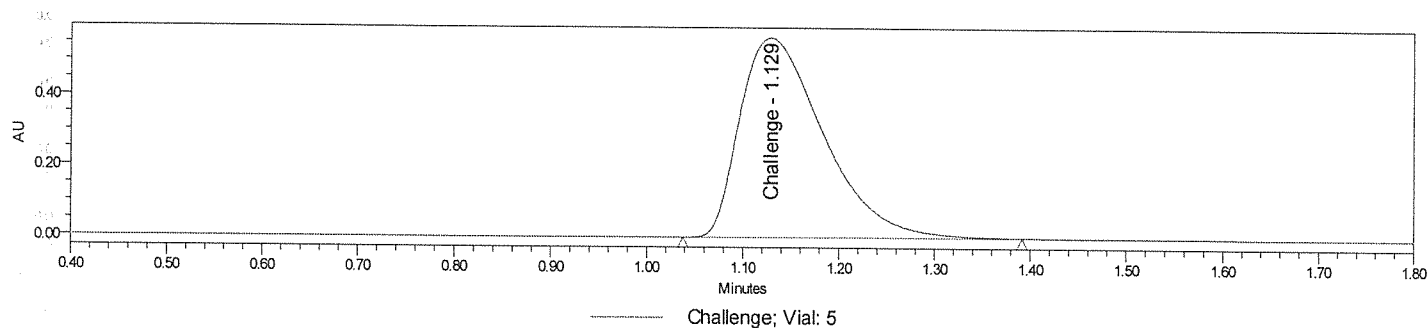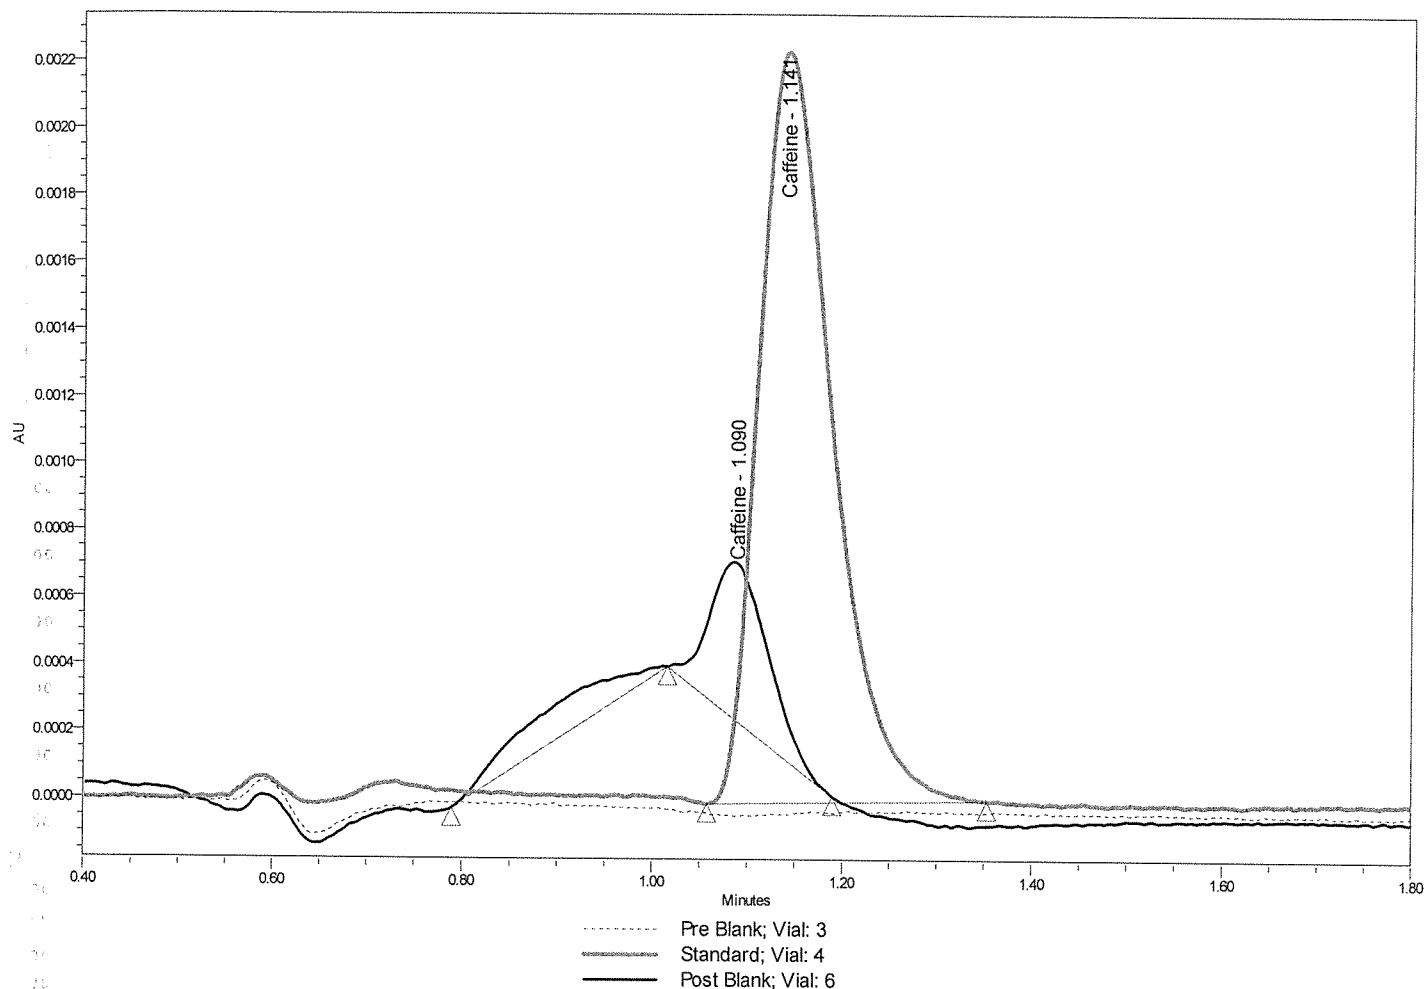

	Date Acquired	SampleName	Area	Percent
1	6/12/2018 12:12:47 PM SGT	Pre Blank		
2	6/12/2018 12:15:31 PM SGT	Standard	11938	0.0100
3	6/12/2018 12:18:14 PM SGT	Challenge	3426172	
4	6/12/2018 12:34:11 PM SGT	Post Blank	2020	0.0017



Carryover Test:
 PreBlank injection (to establish system cleanliness)
 Standard (0.4 PPM) Caffeine injection
 Challenge injection (10,000 X Standard = 4,000 PPM)
 PostBlank injection
 Carryover (%) = Carryover Area/Standard Area * 0.010

Specification: Post Blank Percent < 0.002
 (or Blank peak(s) missing/blank)

This Test Record and any data contained within it are proprietary to Waters Corporation and must be retained by Waters for the time period prescribed in its Quality Records Retention Policy. If any of the individual tests fail, a note must be referenced that details the work performed to correct that specific deficiency. An overall failure indicates a special circumstance in which case a complete retest is to be done. A second form is required to document that testing; the initial form must be attached and retained.

Part Number: 186269506
 Tested By: SYLVESTER
 Serial Number: F18SM4632A
 UUT Firmware: 3.04

Description: 2695 Separations Module
 Test Template Revision: 1.8
 Test Station: Final-test-5
 System: 2695_1

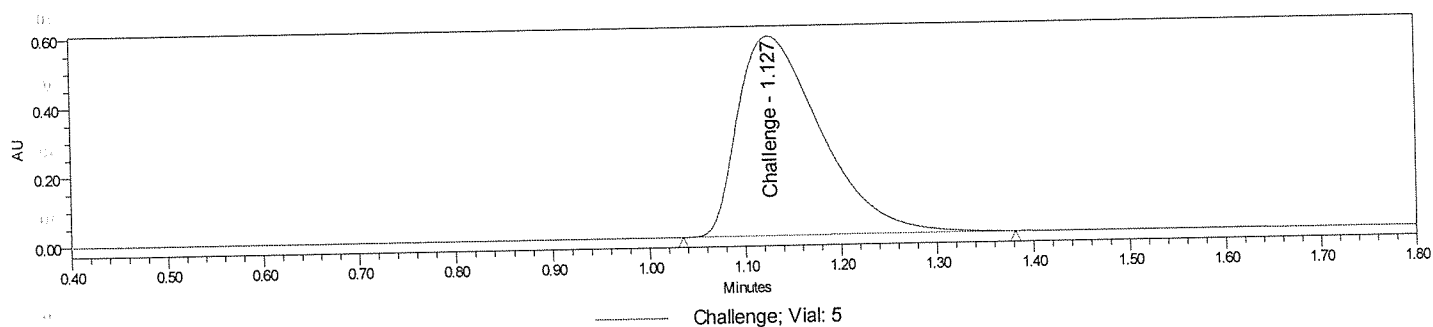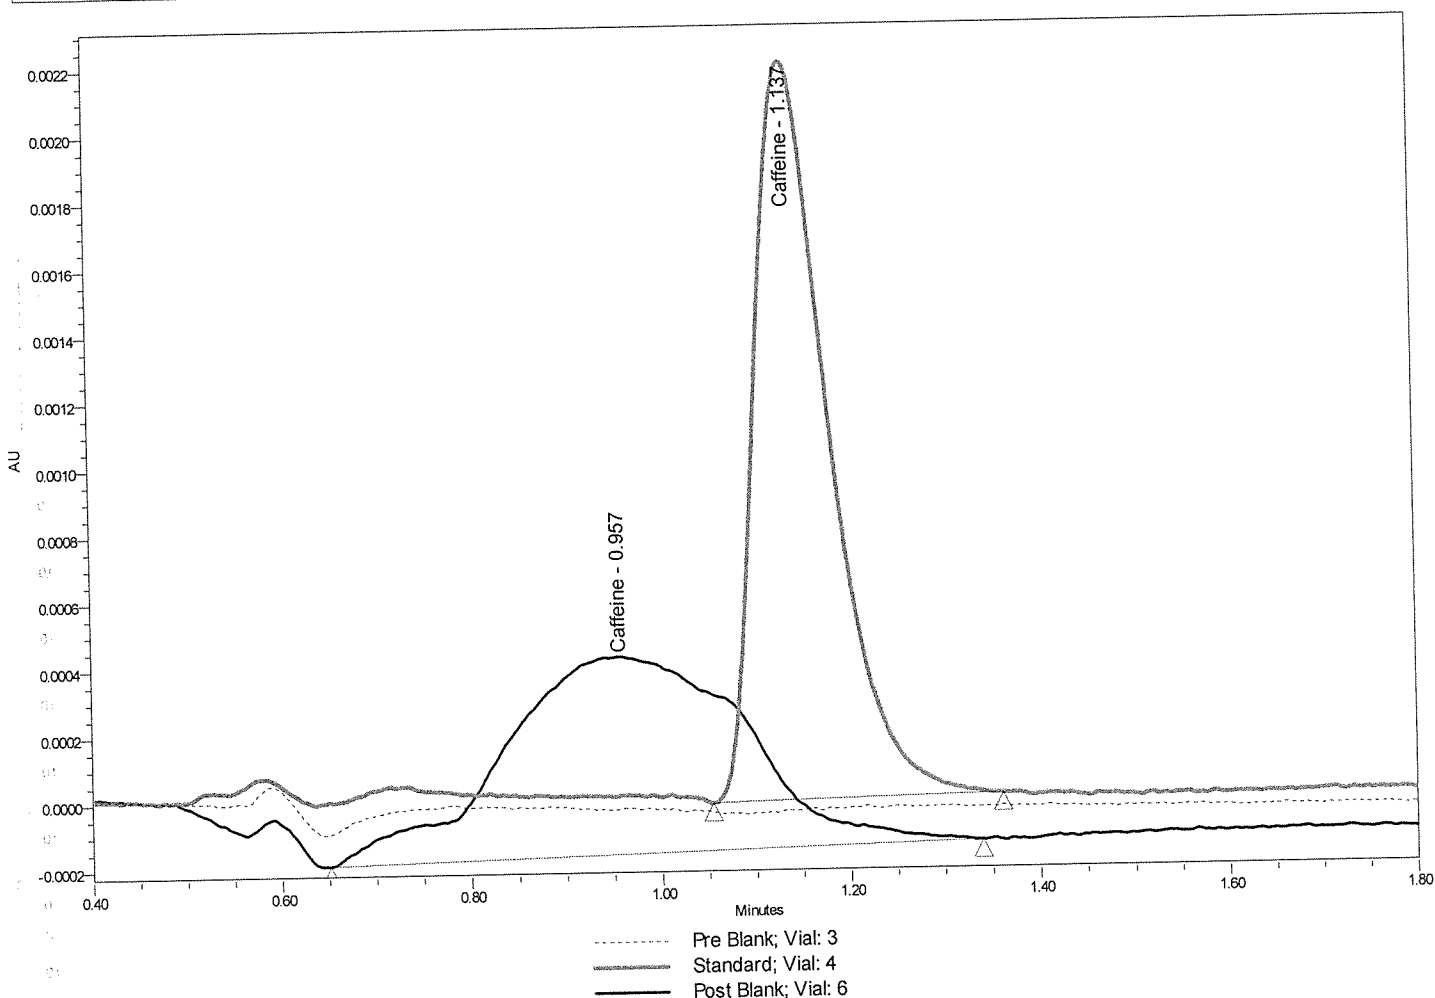

	Date Acquired	SampleName	Area	Percent
1	6/12/2018 4:48:15 PM SGT	Pre Blank		
2	6/12/2018 4:50:56 PM SGT	Standard	11936	0.0100
3	6/12/2018 4:53:36 PM SGT	Challenge	3481459	
4	6/12/2018 5:09:33 PM SGT	Post Blank	10446	0.0088



Carryover Test:
 PreBlank injection (to establish system cleanliness)
 Standard (0.4 PPM) Caffeine injection
 Challenge injection (10,000 X Standard = 4,000 PPM)
 PostBlank injection
 $\text{Carryover (\%)} = \frac{\text{Carryover Area}}{\text{Standard Area}} \times 0.010$

Specification: Post Blank Percent < 0.002
 (or Blank peak(s) missing/blank)

This Test Record and any data contained within it are proprietary to Waters Corporation and must be retained by Waters for the time period prescribed in its Quality Records Retention Policy. If any of the individual tests fail; a note must be referenced that details the work performed to correct that specific deficiency. An overall failure indicates a special circumstance in which case a complete retest is to be done. A second form is required to document that testing; the initial form must be attached and retained.

Part Number: 186269506
 Tested By: SYLVESTER
 Serial Number: F18SM4632A
 UUT Firmware: 3.04

Description: 2695 Separations Module
 Test Template Revision: 1.8
 Test Station: Final-test-2
 System: 2695_2

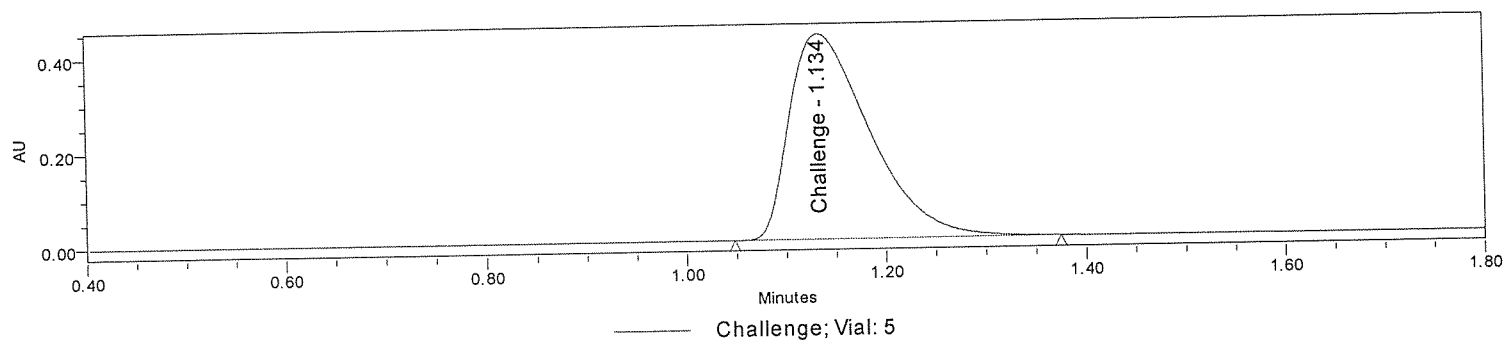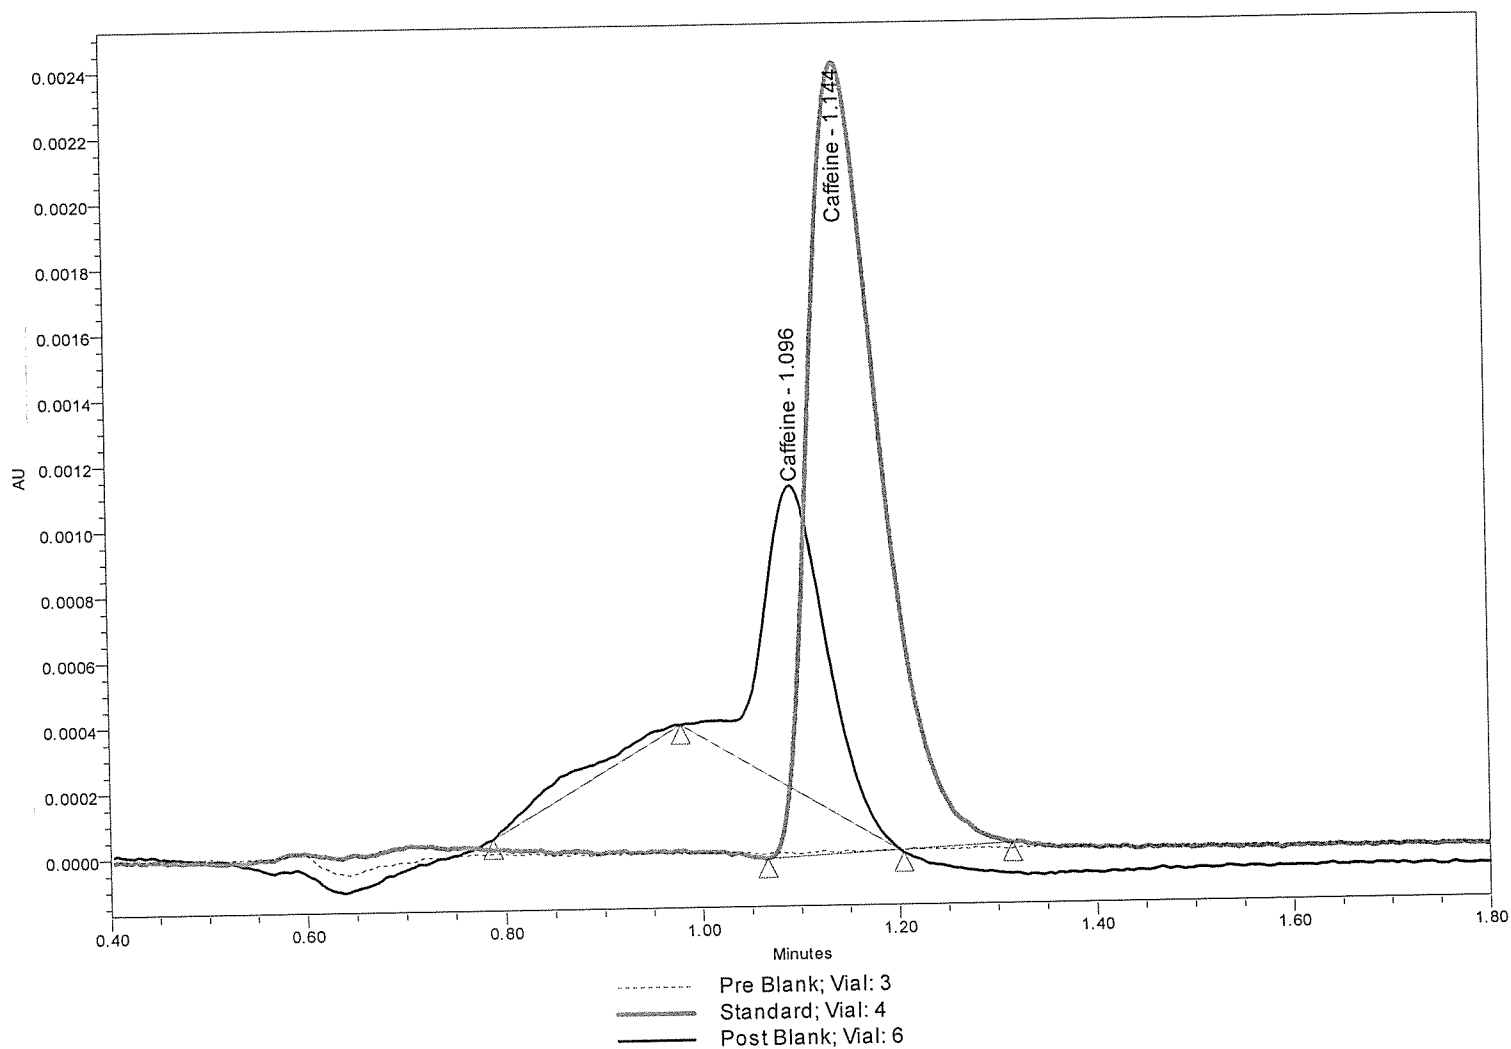

	Date Acquired	SampleName	Area	Percent
1	6/7/2018 5:13:25 PM SGT	Pre Blank		
2	6/7/2018 5:16:09 PM SGT	Standard	12020	0.0100
3	6/7/2018 5:18:53 PM SGT	Challenge	2421771	
4	6/7/2018 5:34:54 PM SGT	Post Blank	4185	0.0035

Carryover Test:



PreBlank injection (to establish system cleanliness)
 Standard (0.4 PPM) Caffeine injection
 Challenge injection (10,000 X Standard = 4,000 PPM)
 PostBlank injection
 Carryover (%) = $\frac{\text{Carryover Area}}{\text{Standard Area}} \times 0.010$

Specification: Post Blank Percent < 0.002
 (or Blank peak(s) are missing/blank)

This Test Record and any data contained within it are proprietary to Waters Corporation and must be retained by Waters for the time period prescribed in its Quality Records Retention Policy. If any of the individual tests fail, a note must be referenced that details the work performed to correct that specific deficiency. An overall failure indicates a special circumstance in which case a complete retest is to be done. A second form is required to document that testing; the initial form must be attached and retained.

Part Number: 186269506
 Tested By: SYLVESTER
 Serial Number: F18SM4632A
 UUT Firmware: 3.04

Description: 2695 Separations Module
 Test Template Revision: 1.8
 Test Station: Final-test-2
 System: 2695_2

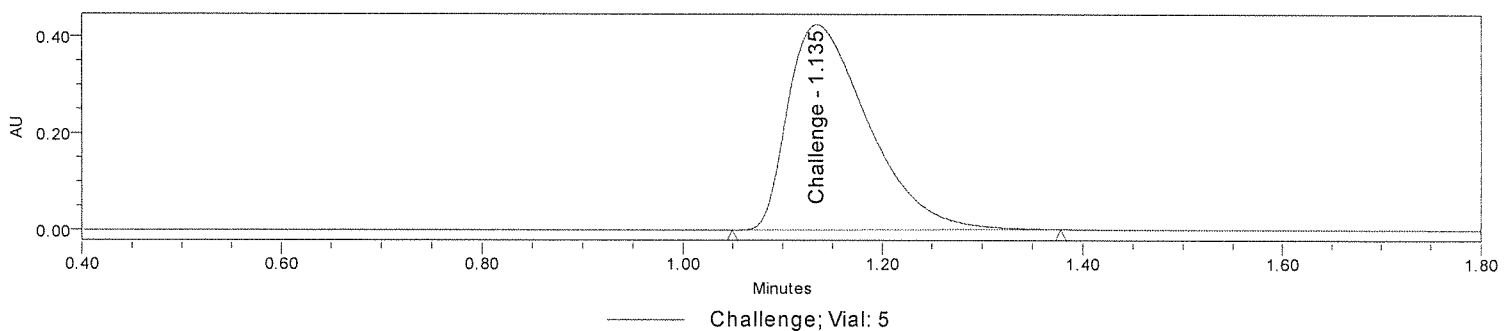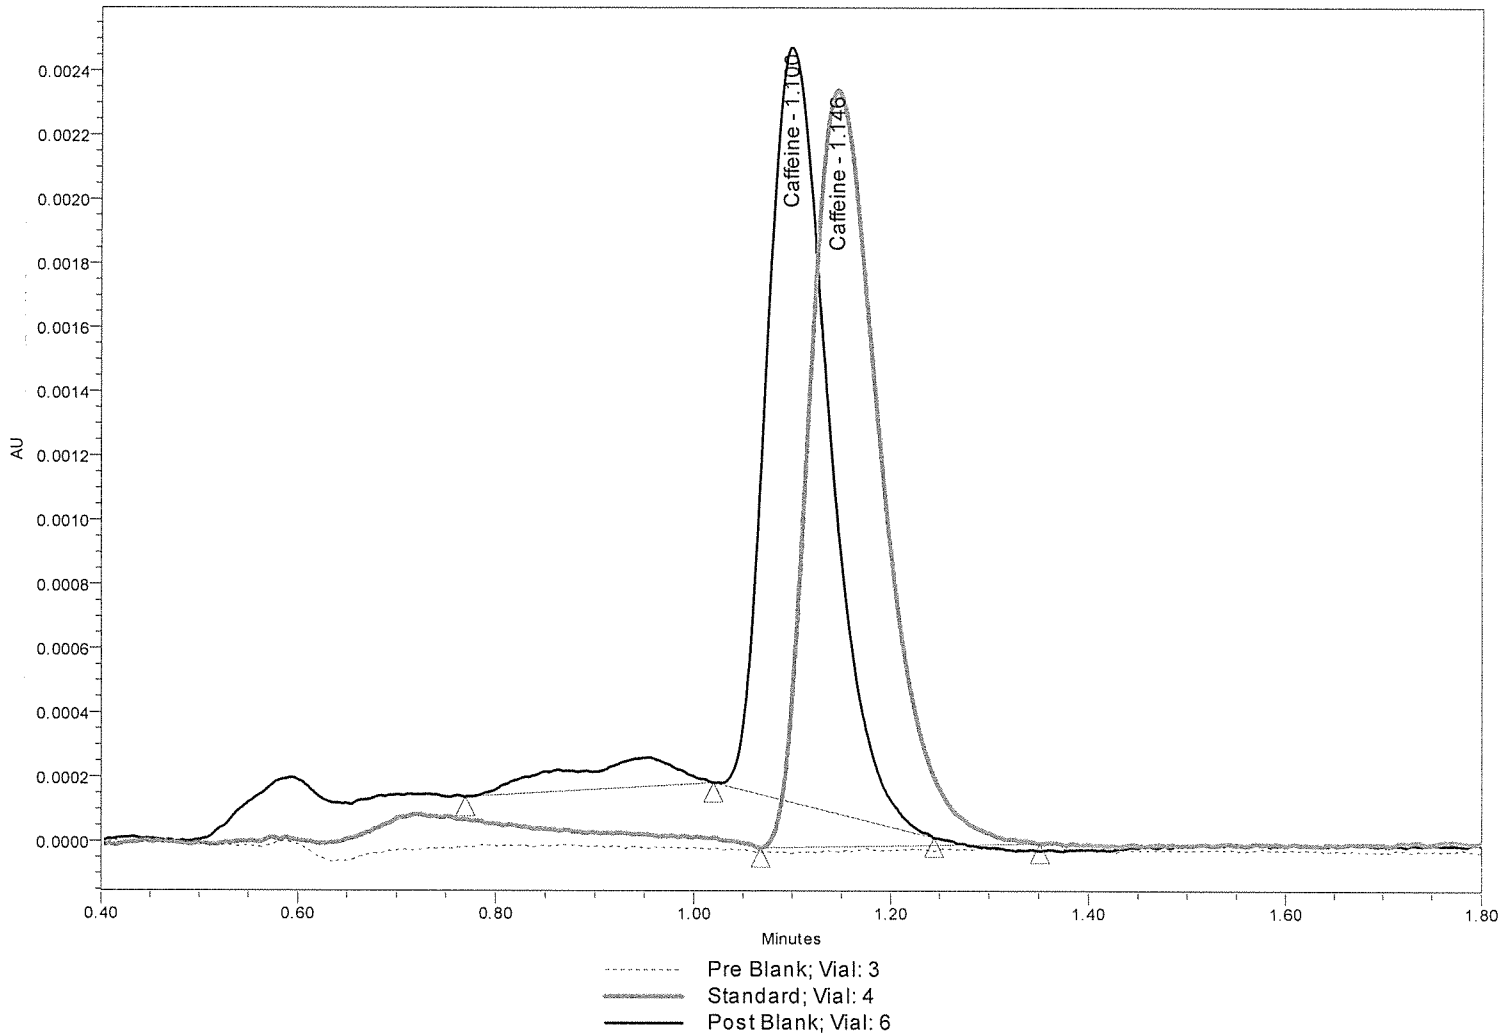

	Date Acquired	Sample Name	Area	Percent
1	6/7/2018 11:19:33 PM SGT	Pre Blank		
2	6/7/2018 11:22:14 PM SGT	Standard	11988	0.0100
3	6/7/2018 11:24:56 PM SGT	Challenge	2373833	
4	6/7/2018 11:40:51 PM SGT	Post Blank	10305	0.0086

Carryover Test:
 PreBlank injection (to establish system cleanliness)
 Standard (0.4 PPM) Caffeine injection
 Challenge injection (10,000 X Standard = 4,000 PPM)
 PostBlank injection
 $\text{Carryover (\%)} = \frac{\text{Carryover Area}}{\text{Standard Area}} \times 0.010$

Specification: Post Blank Percent < 0.002
 (or Blank peak(s) are missing/blank)

This Test Record and any data contained within it are proprietary to Waters Corporation and must be retained by Waters for the time period prescribed in its Quality Records Retention Policy. If any of the individual tests fail, a note must be referenced that details the work performed to correct that specific deficiency. An overall failure indicates a special circumstance in which case a complete retest is to be done. A second form is required to document that testing; the initial form must be attached and retained.